



merit industries, inc.

FIELD BULLETIN

Date: 07-30-01

- Issue:** The thumbscrew on the bottom bill acceptor clamp could interfere with the wires of the bill acceptor.
- Games affected:** Elite MAXX™ with integrated bill acceptor model numbers: G20-106-304-02, -04, -06, -08, -10 and G20-106-307-02
- Symptoms:** The thumbscrew protrudes past the bracket.
- Cause:** The thumbscrew on the clamp is too long.
- Solution:** If you have an Elite MAXX™ with integrated bill acceptor, check the thumbscrew on the bottom bill acceptor clamp (see Figures 1 and 2). If the thumbscrew in your game protrudes past the captive nut on the bracket, contact Merit Industries Customer Service at 1-800-445-9353 or 215-639-4700 to receive a new clamp, which will be equipped with a shorter thumbscrew. Please have your game model number and serial number ready when you call. Be sure to also inspect the wires near the bill acceptor to ensure they have not been damaged. Contact Merit Industries if the wires are damaged.

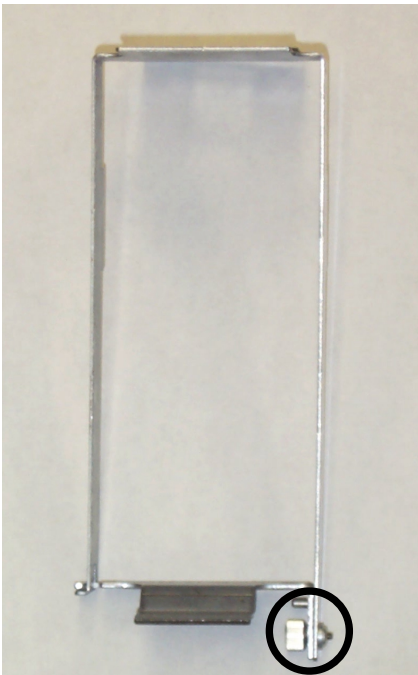


FIGURE 1: LOCATION OF THUMBSCREW ON BILL ACCEPTOR CLAMP

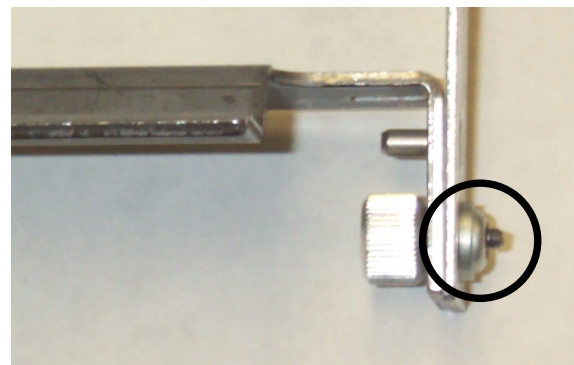


FIGURE 2: CLOSE-UP OF PROTRUDING THUMBSCREW